

NC015 Breaker Replacement Program

Potential problems on certain NC015 and NCO15CP Breakers may exist

Schneider Canada has announced a Voluntary Replacement Program of circuit breakers, they are concerned that some breakers MAY NOT TRIP.

The affected circuit breakers are *Federal Pioneer NC015 and NC015CP, Single Pole Rated 15A, Stab-Lok Circuit Breakers* - Manufactured between August 1, 1996 and June 11, 1997.

These circuit breakers can be identified by ?


BLUE coloured handle.



Note: this includes all NC015 and NC015CP's that were sold loose as well as those sold as part of a FastPak Loadcentre package.

Over 1 million breakers have been manufactured for residential/commercial installations

Replacement breakers are identified by a hole drilled in the handle (Blue color)

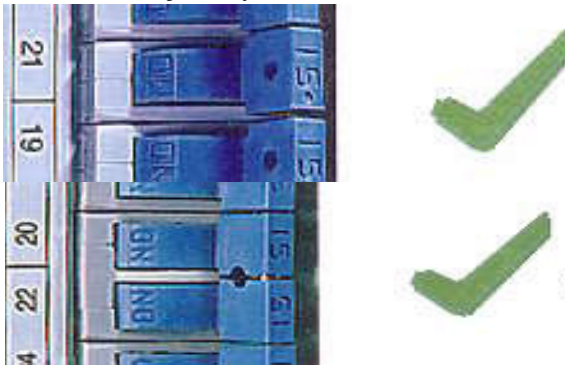

Check for a hole on the blue handle, as illustrated with check marks.

Breakers with black handles are not an issue

Suppliers are being asked:

To cease selling and quarantine any suspect stock of NC015 and NC015CP (*including FastPaks*) as identified above; and contact your local Schneider Canada sales representative to return these.

Electrical Safety Authority Inspectors:

Will not accept these breakers at any installation and will be informing contractors/customers of the problems and necessary action they should be taking.

Customers who have concerns:

Should ensure that any suspect blue handled circuit breaker is less than 1 year old - *and if so,*

- call your contractor to have breaker replaced,
- or
- call 1-888-519-5556 or (416)234-6407 for *additional information*.